

## FIELD INSPECTION REPORT

<b>Project Name:</b>	Mountain Valley Pipeline	<b>Inspector:</b>	Marshall Willis
<b>Inspection Date:</b>	Thursday, April 22, 2021	<b>Project Contact:</b>	Brian Clauto, Cory Chalmers
<b>Spread G: Giles County</b>	STA 11150+00 – 11158+12 STA 11298+29 – 11254+88 MVP-GI-253.02	<b>Weather:</b>	Dry

**ACTIVE STAGE OF CONSTRUCTION:** (Check all that apply)

- Tree Felling     
  Clearing/Grubbing     
  Grading     
  Trenching     
  Stringing/Welding  
 Lowering/Backfilling     
  Final Restoration     
  Temp. Stabilization     
  Perm. Stabilization     
  Dormant

- |    |   | Yes                                 | No                                  | N/A                      |
|----|---|-------------------------------------|-------------------------------------|--------------------------|
| 1. | Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans?                                       | <input type="checkbox"/>            | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| 2. | Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications? | <input checked="" type="checkbox"/> | <input type="checkbox"/>            | <input type="checkbox"/> |
| 3. | Areas of offsite sediment deposition observed?  | <input type="checkbox"/>            | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

Comments: Inspected the following resources: S-MM18, S-MM17 and W-MM10.

**Ineffective Controls:** (*24-Hour Deadline from Notification*)

- STA 11294+50: Waterbar does not extend full width of ROW.
- STA 11287+30: Slope drain does not have outlet protection.
- STA 11286+00: Slope drain does not have outlet protection.
- STA 11281+75: Slope drain does not have outlet protection.
- STA 11281+25: Slope drain does not have outlet protection.
- STA 11278+50: Slope drain does not have outlet protection.
- STA 11276+00: Slope drain does not have outlet protection.
- STA 11274+00: Slope drain does not have outlet protection.
- STA 11270+00: Slope drain does not have outlet protection.

**Recommended Corrective Action:** Maintain and install all controls per the approved PSS&S.

**Deadline:** Within 24-Hour of Notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.

**Inspector Signature:** 

**Date:** Thursday, April 22, 2021

## FIELD INSPECTION PHOTO LOG

**Project Name:** Mountain Valley Pipeline

**Date:** Thursday, April 22, 2021

**Figure 1: STA 11294+50** – Waterbar does not extend full width of ROW.

**BRG:** 237°SW (T) **LAT:** 37.296630 **LON:** -80.480966 ±16ft **ALT:** 2106ft



**Figure 2: STA 11287+30** – Slope drain does not have outlet protection.

**BRG:** 160°S (T) **LAT:** 37.296118 **LON:** -80.483404 ±16ft **ALT:** 2256ft



**Figure 3: STA 11286+00** – Slope drain does not have outlet protection.

**BRG:** 157°SE (T) **LAT:** 37.296067 **LON:** -80.483847 ±16ft **ALT:** 2269ft



**Figure 4: STA 11281+75** – Slope drain does not have outlet protection.

**BRG:** 83°E (T) **LAT:** 37.295886 **LON:** -80.485273 ±16ft **ALT:** 2279ft



## FIELD INSPECTION PHOTO LOG

**Project Name:** Mountain Valley Pipeline

**Date:** Thursday, April 22, 2021

**Figure 5: STA 11281+25** – Slope drain does not have outlet protection.  
 BRG: 122°SE (T) LAT: 37.295792 LON: -80.485271 ±16ft ALT: 2273ft



**Figure 6: STA 11278+50** – Slope drain does not have outlet protection.  
 BRG: 321°NW (T) LAT: 37.295762 LON: -80.486173 ±16ft ALT: 2241ft



**Figure 7: STA 11276+00** – Slope drain does not have outlet protection.  
 BRG: 241°SW (T) LAT: 37.295868 LON: -80.487126 ±16ft ALT: 2281ft



**Figure 8: STA 11274+00** – Slope drain does not have outlet protection.  
 BRG: 11°N (T) LAT: 37.295878 LON: -80.487701 ±32ft ALT: 2263ft



## FIELD INSPECTION PHOTO LOG

**Project Name:** Mountain Valley Pipeline

**Date:** Thursday, April 22, 2021

**Figure 9: STA 11270+50** – Slope drain does not have outlet protection.

**BRG:** 60°NE (T) **LAT:** 37.296030 **LON:** -80.489169 ±32ft **ALT:** 2194ft

